

# Attic Fans

## Power Attic Mount Dome Ventilator



**WARNING:** This product can expose you to chemicals including nickel which is known to the State of California to cause cancer, and chromium, which is known to the State of California to cause birth defects and/or reproductive harm. For more information go to [www.P65Warnings.ca.gov](http://www.P65Warnings.ca.gov).

### Features

- 120V Motor / 1-Phase
- Automatic thermostat (60°-120°F)
- Insect and bird screen installed
- Black or brown painted finish or mill finish

Note: Photograph is a representation of stocked models. Actual model may vary in appearance.

### Standard Models

MFG CATALOG NUMBER	MFG MODEL NUMBER	DOMES COLOR	SPEED	CFM .03 SP	VOLTS	HP	RPM	ATTIC SIZE / SQ. FT.*	WT. (LBS)	LIST
08664202	PDV-305-1MB-GY-G	Mill	1	1000	120	1/12	1050	Average/1600	19	197
08664302	PDV-305-1MB-BR-G	Brown	1	1000	120	1/12	1050	Average/1600	19	
08664402	PDV-305-1MB-BLK-G	Black	1	1000	120	1/12	1050	Average/1600	19	

\*@ 4:12 Pitch Roof

## Gable Exhaust Fan



Damper requires  
16 1/2 x 16 1/2 opening



**WARNING:** This product can expose you to chemicals including nickel which is known to the State of California to cause cancer, and chromium, which is known to the State of California to cause birth defects and/or reproductive harm. For more information go to [www.P65Warnings.ca.gov](http://www.P65Warnings.ca.gov).

### Features


- 120V motor / 1-Phase
- Automatic adjustable thermostat (60°-120°F)
- Partially assembled (mounting tabs must be assembled)
- 14" blade diameter
- 4 mounting tabs on 16" centers

### Standard Models

MFG CATALOG NUMBER	MFG MODEL NUMBER	DESCRIPTION	CFM .03 SP	ATTIC SIZE/ SQ. FT.*	WT. (LBS)	LIST
08663702	GV-405-2B-G	Gable Mount Ventilator	1540	Average/2400	13	153
08665202	AGD-1616B-G	White Aluminum Damper for GV-405-2	----	----	3	89

\*@ 4:12 Pitch Roof

## Belt Drive Wholehouse Fans

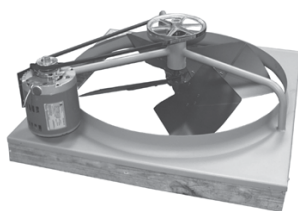

**WARNING:** This product can expose you to chemicals including nickel which is known to the State of California to cause cancer, and chromium, which is known to the State of California to cause birth defects and/or reproductive harm. For more information go to [www.P65Warnings.ca.gov](http://www.P65Warnings.ca.gov).


### Features

- 120V, 1-Phase, 2-Speed motors
- Shutters automatically open when fan is turned on and close tightly when fan is turned off
- Made in U.S.A.

**NOTE:** Belt Drive Fan with "No Joist Cut" Shutter.

### Standard Models

MFG CATALOG NUMBER	MFG MODEL NUMBER	SIZE	SPEED	MOTOR HP	CFM @ .1 IN. H2O PRESSURE DROP w/ SHUTTER	FAN SPEED RPM	FAN MOUNTING DIMENSIONS (IN)			EXHAUST SQ. FT. REQ'D	AMPS	WT. (LBS)	LIST
							A	B	C				
07936202	BD24-2-WHS	24"	2	1/3	4500/2700	612/410	28	29.5	14.5	7	5.7/4.8	40	892
07936302	BD30-2-WHS	30"	2	1/3	7600/5800	520/350	34	35.5	14.5	9	6.9/5.5	50	959
07936402	BD36-2-WHS	36"	2	1/3	9675/6400	395/265	40	41.5	14.5	12	6.3/3.1	64	1054

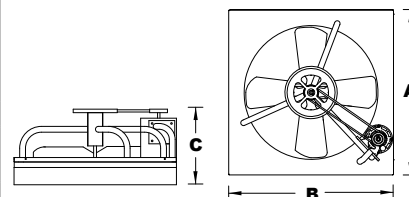

### Ceiling Shutters

MFG CATALOG NUMBER	MFG MODEL NUMBER	FIT HOLE SIZE (I.D.)	OUTSIDE SIZE (O.D.)	FAN SIZE	WT. (LBS)	LIST
07944802	CS-10-W	26X26	28X28	24"	8	158
07944602	CS-13-W	32X34	34X36	30"	10	165
07945302	CS-14-W	34X34	36X36	30"	10	173
07944702	CS-18-W	32X43	34X45	36"	11	188
07945202	CS-19-W	34X43	36X45	36"	11	203

"Joist out style" (For replacement only)

### Control Options

MFG CATALOG NUMBER	MFG MODEL NUMBER	DESCRIPTION	WT. (LBS)	LIST
07927002	2-SW	2 Speed wall switch & plate	1	45
05000802	1A22-7	SP Close on rise (Attic Thermostat) (80°-130°F)	1	53

**WARNING:** This product can expose you to chemicals including nickel which is known to the State of California to cause cancer, and chromium, which is known to the State of California to cause birth defects and/or reproductive harm. For more information go to [www.P65Warnings.ca.gov](http://www.P65Warnings.ca.gov).